

# Operating the NCD+ 500b Contact Gun



## Instruction & Maintenance Manual (729-110-048)



### **CAUTION**

*These instructions are intended for experienced operators.*

If you are not fully familiar with the principles of operation and safe practices for arc welding equipment, we urge you to read AWS SP – “Safe Practices” available from the American Welding Society.

***Do not permit untrained persons to install, operate or maintain the equipment. Do not attempt to install or operate the equipment until you have read and fully understand these instructions.***

If you do not fully understand these instructions, contact your supplier for further information. Be sure to read the Safety section before utilizing this equipment.

# NCD+ Limited Warranty

Nelson's only warranty is that goods being sold will be free from defects in workmanship and material. This warranty is expressly in lieu of other warranties, expressed or implied and whether statutory or otherwise, including any implied warranty of merchantability or fitness for a particular purpose.

Nelson's liability for breach of warranty shall arise only upon return of the defective goods at Buyer's expense after notice to Nelson of the claimed breach, and shall be limited to furnishing a like quantity of such goods free from such defects or, at Nelson's option, to refunding the purchase price (less reasonable depreciation based on actual use); provided, however, that Nelson will not accept receipt of equipment returned unless buyer has previously afforded Nelson's personnel a reasonable opportunity to inspect and repair said equipment at buyer's facility or such other location as is mutually agreeable. Notice to Nelson must be given within 30 days of such defect or failure and within 90 days from the date the equipment was delivered. No compensation or reimbursement for transportation costs of any kind will be allowed.

Please note that this warranty does not extend beyond the original registered purchaser, and does not warrant equipment that has been modified by any party other than Nelson, or equipment that has been improperly installed, improperly operated, or misused based upon industry standards, or equipment which has not had reasonable and necessary maintenance, or equipment which has been used for operation outside of specifications for the equipment. Nelson shall never be liable for consequential damages.

Nelson reserves the right to make engineering and/or part changes, at any time without notice, as a result of our commitment to continuous improvement.



## WARNING

### WARNING

The following Safety section is for your protection. It summarizes precautionary information from the references listed in the Additional

Safety Information section. Before performing any installation or operating procedures, be sure to read and follow the safety precautions listed below as well as all other manuals, material safety data sheets, labels, etc. Failure to observe these precautions can result in injury or death.



### PROTECT YOURSELF AND OTHERS

**Some welding, cutting, and gouging processes are noisy and require ear protection. The arc, like the sun, emits ultraviolet (UV) rays and other radiation which can harm the skin and eyes. Hot metal can cause burns. Training in the proper use of the processes and equipment is essential to prevent accidents. Therefore:**

1. Always wear safety glasses with side shields in any work area, even if welding helmets, face shields and goggles are also required.
2. Use a face shield fitted with filter shade #3 per ANSI Z87.1. Cover sparks and rays of the arc when operating or observing operations. Warn bystanders not to watch the arc and not to expose themselves to the rays of the electric-arc or hot metal.
3. Wear flameproof gauntlet type gloves, heavy long-sleeve shirt, cuffless trousers, high topped shoes, and a welding helmet or cap for hair protection, to protect against arc rays and hot sparks or hot metal. A flameproof apron may also be desirable as protection against radiated heat and sparks.
4. Hot sparks or metal can lodge in rolled up sleeves, trousers cuffs or pockets. Sleeves and collars should be kept buttoned and open pockets eliminated from the front of clothing.
5. Protect other personnel from arc rays and hot sparks with suitable nonflammable partitions or curtains.
6. Use goggles over safety glasses when chipping slag or grinding. Chipped slag may be hot and can fly far. Bystanders should also wear goggles over safety glasses.



### FIRES AND EXPLOSIONS

**Heat from flames and arcs can start fires. Hot slag or sparks can also cause fires and explosions. Therefore:**

1. Remove all combustible materials well away from the work area or cover the materials with a protective nonflammable covering. Combustible materials include wood, cloth, sawdust, liquid and gas fuels, solvents, paints and coatings, paper, etc.
2. Hot sparks or hot metal can fall through cracks or crevices in floors or wall openings and cause a hidden smoldering fire or fires on the floor below. Make certain that such openings are protected from hot sparks and metal.
3. Do not weld, cut, or perform other hot work until the work piece has been completely cleaned so that there are no substances on the work piece which might produce flammable or toxic vapors. Do not do hot work on closed containers. They may explode.
4. Have appropriate fire extinguishing equipment handy for instant use, such as a garden hose, water pail, sand bucket or portable fire extinguisher. Be sure you are trained for proper use.
5. Do not use equipment beyond its ratings. For example, overloaded welding cable can overheat and create a fire hazard.
6. After completing operations, inspect the work area to make certain there are no hot sparks or hot metal which could cause a later fire. Use fire watchers when necessary.
7. For additional information, refer to NFPA Standard 51B, "Fire Prevention in Use of Cutting and Welding Processes," available from the National Fire Protection Association, Batterymarch Park, Quincy, MA 02269



### ELECTRICAL SHOCK

**Contact with live electrical parts and ground can cause severe injury or death. DO NOT use welding current in damp areas, if movement is confined, or if there is danger of falling. Therefore:**

1. Be sure the power source frame (chassis) is connected to the ground system of the input power.
2. Connect the work piece to a good electrical ground.
3. Connect the work cable to the work piece. A poor or missing connection can expose you or others to a fatal shock.
4. Use well-maintained equipment. Replace worn or damaged cables.
5. Keep everything dry, including clothing, work area, cables, torch/electrode holder and power source.
6. Make sure that all parts of your body are insulated from work and from the ground.
7. Do not stand directly on metal or the earth while working in tight quarters or a damp area; stand on dry boards or an insulating platform and wear rubber soled shoes.
8. Put on dry, hole-free gloves before turning on the power.
9. Refer to ANSI/ASC Standard Z49.1 for specific grounding recommendations. Do not mistake the work lead for a ground cable.



### ELECTRICAL AND MAGNETIC FIELDS

**Electric and magnetic fields may be dangerous. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding and cutting current creates EMF around welding cables and welding machines. Therefore:**

1. Operators having pacemakers should consult their physician before welding. EMF may interfere with some pacemakers.
2. Exposure to EMF may have other health effects which are unknown.
3. Operators should use the following procedures to minimize exposure to EMF:
  4. Route the electrode and work cables together. Secure them with tape when possible.
  5. Never coil the torch or work cable around your body.
  6. Do not place your body between the torch and work cables. Route cables on the same side of your body.
  7. Connect the work cable to the work piece as close as possible to the area being welded.
  8. Keep welding power source and cables as far away from your body as possible.



### FUMES AND GASES

**Fumes and gases can cause discomfort or harm, particularly in confined spaces. Do not breathe fumes and gases. Shielding gases can cause asphyxiation. Therefore:**

1. Always provide adequate ventilation in the work area by natural or mechanical means. Do not weld, cut, or gouge on materials such as galvanized steel, stainless steel, copper, zinc, lead, beryllium, or cadmium unless positive mechanical ventilation is provided. Do not breathe fumes from these materials.
2. Do not operate near degreasing and spraying operations. The heat or arc rays can react with chlorinated hydrocarbon vapors to form phosgene, a highly toxic gas, and other irritant gasses.
3. If you develop momentary eye, nose, or throat irritation while operating, this is an indication that ventilation is not adequate. Stop work and take necessary steps to improve ventilation in the work areas. Do not continue to operate if physical discomfort persists.
4. Refer to ANSI/ASC Standard Z49.1 (see listing on next page) for specific ventilation recommendations.



#### ELECTRICALLY POWERED EQUIPMENT

Faulty or improperly electrified equipment can cause injury or death. Therefore:

1. Always have qualified personnel perform the installation, troubleshooting, and maintenance work. Do not perform any electrical work unless you are qualified to perform such work.
2. Before performing any work inside a power source, disconnect the power source from the incoming electrical power using the disconnect switch at the fuse box before working on the equipment.
3. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacture's recommendations.
4. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.



#### CYLINDER HANDLING

Cylinders, if mishandled, can rupture and violently release gas. Sudden rupture of cylinder, valve, or relief device can injure or kill. Therefore:

1. Use the proper gas for the process and use the proper pressure reducing regulator designed to operate from the compressed gas cylinder. Do not use adaptors. Maintain hoses and fittings in good condition.
2. Always secure cylinders in an upright position by chain or strap to suitable hand trucks, undercarriages, benches, walls, post, or racks. Never secure cylinders to work tables or fixtures where they may become part of an electrical circuit.
3. When not in use, keep cylinder valves closed. Have valve protection cap in place if regulator is not connected. Secure and move cylinders by using suitable hand trucks. Avoid rough handling of cylinders.
4. Locate cylinders away from heat, sparks, and flames. Never strike an arc on a cylinder.
5. For additional information, refer to CGA Standard P-1, "Precautions for Safe Handling of Compressed Gases in Cylinders", which is available from Compressed Gas Association, 1235 Jefferson Davis Highway, Arlington, VA 22202.



#### HEARING PROTECTION

Prolonged Noise from Capacitor Discharge welding applications can damage hearing if levels exceed limits specified by OSHA. Therefore:


1. Use Approved ear plugs or ear muffs if noise level is high.
2. Warn others nearby about noise hazard.
3. For additional information, refer to OSHA Safety Standards 3074.



#### MOVING PARTS CAN CAUSE INJURY

Electric fan can start at any time without warning and cause severe injury, therefore:

1. Always disconnect electrical power prior to service to prevent the fan from starting unexpectedly.
2. Keep all doors, panels, covers, and guards closed and securely in place.
3. Have only qualified people remove guards or covers for maintenance and troubleshooting as necessary.
4. Keep hands, hair, loose clothing, and tools away from moving parts.
5. Reinstall panels or guards and close doors when servicing is finished and before reenergizing welder.

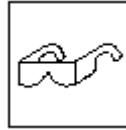

#### EYE PROTECTION

Flying metal can injure eyes. Welding, chipping, wire brushing and grinding can cause sparks and flying metal. As welds cool, they can throw off slag. Therefore:

1. Wear approved safety glasses with side shields even under your welding helmet.
2. Warn others nearby about flying metal hazard.



#### EQUIPMENT MAINTENANCE

Faulty or improperly maintained equipment can cause injury or death. Therefore:

1. Always have qualified personnel perform the installation, troubleshooting, and maintenance work. Do not perform any electrical work unless you are qualified to perform such work.
2. Before performing any maintenance work inside a power source, disconnect the power source from the incoming electrical power.
3. Maintain cables, grounding wire, connections, power cord, and power supply in safe working order. Do not operate any equipment in faulty condition.
4. Do not abuse any equipment or accessories. Keep equipment away from:
  - heat sources such as furnaces
  - wet conditions such as water puddles and inclement weather
  - oil or grease
  - corrosive atmospheres
5. Keep all safety devices and cabinet covers in position and in good repair.
6. Use equipment only for its intended purpose. Do not modify it in any manner.



#### ADDITIONAL SAFETY INFORMATION

For more information on safe practices for electric arc welding, refer to the following publications.

1. ANSI/ASC Z49.1 Safety in Welding and Cutting
2. AWS C5.1 Recommended Practices for Plasma Arc Welding
3. AWS C5.6 Recommended Practices for Gas Metal Arc Welding
4. AWS SP Safe Practices (Reprint) Welding Handbook
5. ANSI/AWS F4.1 Recommended Safe Practices for Welding and Cutting of Containers That Have Held Hazardous Substances.

# CONTENTS

1	Overview .....	7
1.1	Nelson Pinnacle NCD+ 500b Welding Mode .....	8
2	Features .....	9
3	Gun Set-Up .....	10
3.1	Chuck Assembly Instructions .....	10
3.1.1	Chuck Assembly.....	10
3.1.2	Adjusting Chuck and Stop Assembly .....	10
3.1.3	Adjusting Stud Stop Assembly .....	10
3.2	Setting Up Foot and Leg Assembly .....	11
3.3	Setting Spring Pressure.....	12
4	Weld Setup.....	13
4.1	Post Weld .....	13
5	Maintenance of Stud Welding System .....	14
5.1	Stud Welding Gun .....	14
5.2	Welding Cable / Control Cable .....	14
5.3	Power Control Unit .....	14
6	Troubleshooting .....	15
6.1	Visual Weld Inspection and Weld Parameter Adjustments.....	15
6.2	Weld Quality Physical Inspection and Weld Parameter Adjustments .....	15
6.2.1	Recommendations .....	15
7	Assembly Drawing & Parts List .....	18
7.1	Parts List .....	18
7.2	Assembly Drawing.....	20
7.3	Electrical Functions of Guns.....	21
7.3.1	Triggering Contact .....	21
7.3.2	Dismantling & Reassembling Contact Welding Gun.....	21
8	Schematics.....	22
8.1	NCD+ 500b CTRL TO GUN, 7 PIN .....	22
9	Technical Specifications .....	23

9.1 Specifications .....23  
9.2 Weld Tool Dimensions.....23  
9.3 Accessories .....24  
9.4 Table of Weld Parameters ..... 25  
10 Contact Information ..... 26





# 1 Overview

The Nelson NCD+ stud welding guns are made to be used with Nelson NCD+ stud welding power units, which utilize the capacitor discharge principal of stud welding. This system is designed to use fasteners, which are manufactured with a small projection on the weld end and are welded by either the Contact or Gap method. Heat for fusion is obtained from an electric arc, which is established by flashing away the small projection. The discharge of the welding current or energy stored in the capacitors produces an arc that melts the end of the stud and a portion of the base material. The stud is forced into the molten metal before the conclusion of the arc cycle. Upon cooling, a uniform cross section bond is achieved. A special advantage of the capacitor discharge process is the limited heat generated, and low penetration which allows the fasteners to be welded to thin and/or coated parts opposite the weld side.


Contact welding is generally used with carbon steel and stainless steel especially when weld appearance is not a prime consideration. The contact welding setup is easier to make and the contact mode is somewhat more tolerant to work piece flexing.

The welding guns in this series are a “contact gun” which is suitable only for contact welding.

**NOTE:** Depending upon the weld setup established for any particular stud size or material, the noise generated by the flashing away of the stud tip may exceed the allowable level established by the Occupational Safety and Health Administration (Section 50-204.10 of the Federal Register, Part II). For this reason, it is recommended that the stud welding operator and anyone working within the immediate area of the stud welding operation use proper ear protection.

<b>SAFETY SYMBOLS</b> <b>ATTENTION! BE ALERT! Your safety is involved.</b>  	 <b>DANGER</b>	Used to call attention to immediate hazards which, if not avoided, will result in immediate, serious personal injury or loss of life.
	 <b>WARNING</b>	Used to call attention to potential hazards which could result in personal injury or loss of life.
	 <b>CAUTION</b>	Used to call attention to hazards which could result in minor personal injury.

## 1.1 Nelson Pinnacle NCD+ 500b Welding Mode

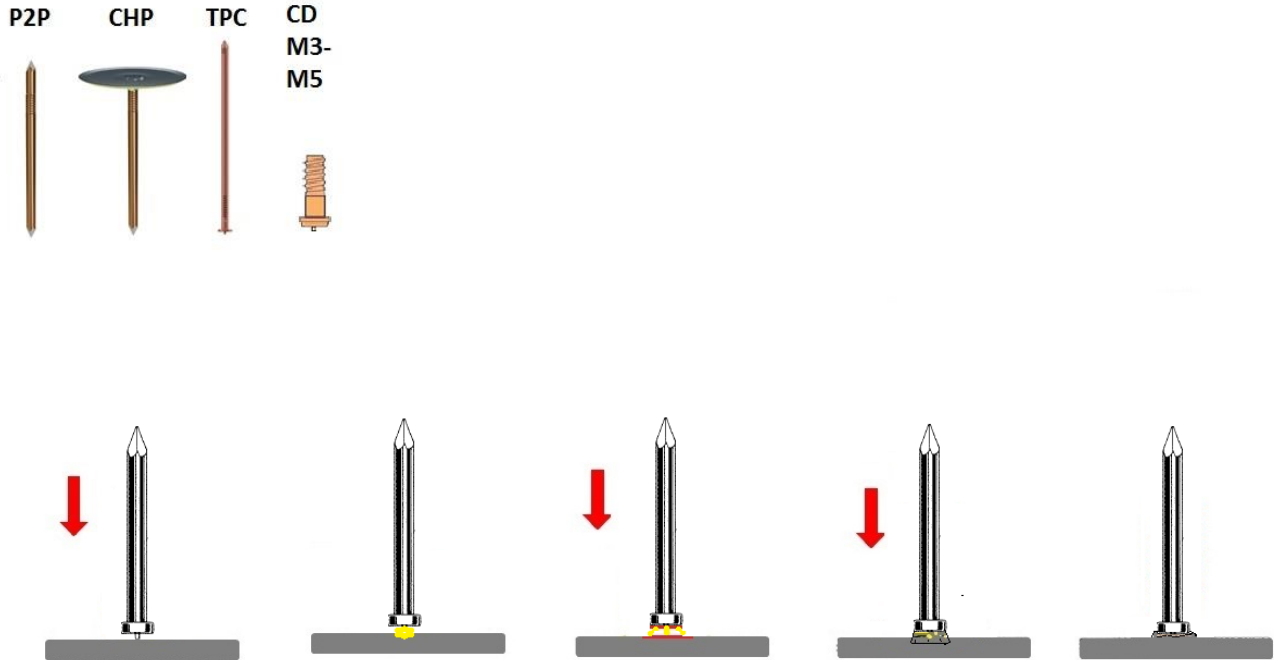


The NCD+ 500b gun operates as a capacitor discharge **contact** gun. A coil does not lift the stud in this application. When the trigger is pulled, the capacitors discharge as the stud is held firmly against the workpiece. The tip is flashed off, that establishes an arc and allows the stud to plunge.


1. Gun is loaded and properly positioned with the stud in contact with the work. Operator takes up the spring pressure.
2. The trigger is closed and the projection tip or point is flashed off, leaving an arc space.
3. The remaining stored energy is discharged across the arc space (Pin and base material are heated).
4. The spring pressure plunges the pin into the work piece.
5. The weld solidifies and connection is complete.



## 2 Features

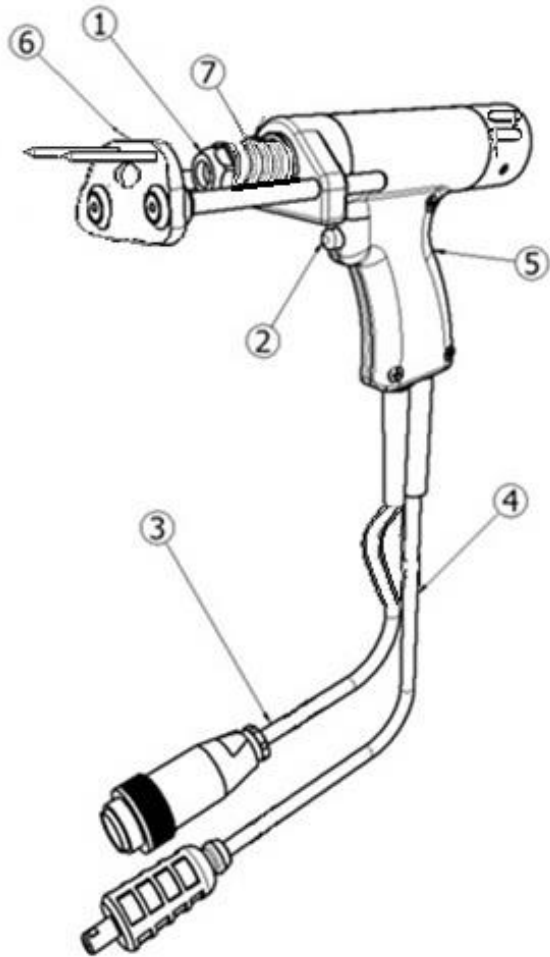

1	CHUCK NUT
2	TRIGGER
3	CONTROL CABLE
4	WELD CABLE
5	GUN BODY (2 HALVES)
6	FOOT ASSEMBLY
7	BELLOWS
8	SPRING ADJUSTMENT SCREW
9	SPRING PRESSURE GAUGE

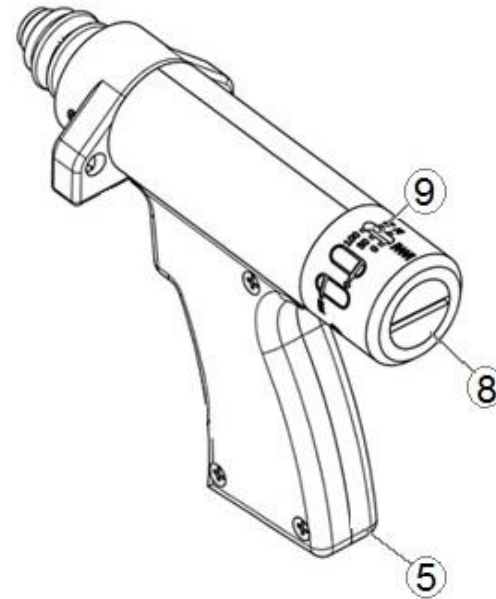

## 3 Gun Set-Up

### 3.1 Chuck Assembly Instructions



#### CAUTION

The unit should be switched off before inserting or changing a chuck.

#### 3.1.1 Chuck Assembly

At the beginning of a welding series or in case of a necessary change to different stud dimensions, the chuck must be set to the correct stud type.

The chucks (**Figure 3.1 Chuck and Stop Assembly**) are not included and should be ordered separately. See [Accessories](#) for correct sizes and part numbers.

#### Job Preparation

Tools Required: Screwdriver, open-end wrench (7mm, 8mm), and caliper gauge

- 1 Select chuck with the correct diameter for the stud to be welded.
- 2 Stop pin assembly for the proper stud length.

#### 3.1.2 Adjusting Chuck and Stop Assembly



#### CAUTION

The unit should be switched off before inserting or changing a chuck.

#### To adjust the Chuck and Stop Assembly (**Figure 3.1 Chuck and Stop Assembly**):

The proper size chuck for the type of stud being welded must be used to ensure good electrical contact between the stud and the stud chuck. If the stud fit seems too loose with the proper chuck, the chuck tines may be pressed slightly together at the front end of the chuck.

#### 3.1.3 Adjusting Stud Stop Assembly

- 1 Loosen the set screw.
- 2 Adjust the stud stop so that the stud being welded extends 4 mm beyond the chuck.
- 3 Tighten set screw.

NOTE: For long studs, use maximum chuck depth. The chuck is assembled as shown and inserted into the chuck adaptor. The chuck must be in firm contact with the stud stop while tightening the chuck nut.


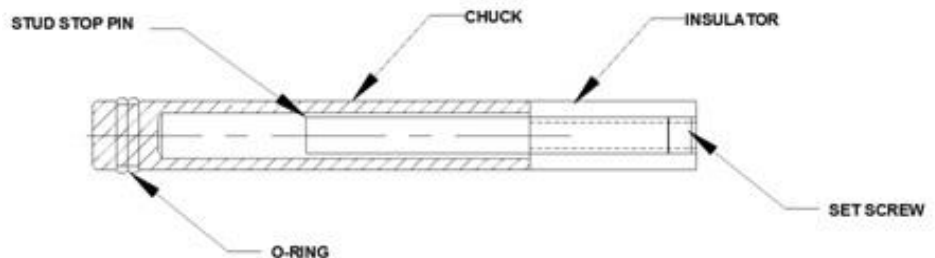


Figure 3.1 Chuck and Stop Assembly

### 3.2 Setting Up Foot and Leg Assembly

The NCD+ guns come supplied with a foot and locating pins (**Figure 3.2** Locating Pin Foot & Leg Assembly). The foot is installed on the end of the legs. Alignment of the foot is important. The chuck should be located in the center of the foot opening. To install the foot, unscrew the leg screws and place them through the holes in the foot. Reattach the leg screws to the legs. Maintain concentricity between the chuck and foot opening.

Figure 3.2 Locating Pin Foot & Leg Assembly

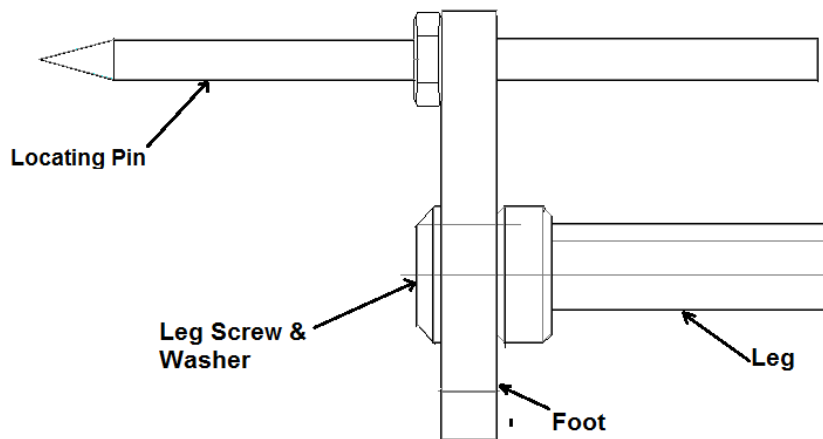

\*See section 7 for part numbers

### 3.3 Setting Spring Pressure

Required tools: NCD+ 500b Weld gun, chuck and foot per application, NCD+ Set-Up Tool (Figure 3.3 Contact Gun with NCD+ Set-Up Tool #525-001-200) or flat bladed screwdriver

- 1 Check **The Table of Weld Parameters** for the recommended spring pressure.
- 2 With a flat bladed screwdriver or NCD+ Set-Up Tool, turn adjustment screw on the back of the weld gun to the recommended spring pressure.
- 3 Adjust stud stick out.
- 4 Loosen leg screws.
- 5 Insert stud in chuck
- 6 Place NCD+ Set-Up Tool on a flat surface and insert stud into Contact Mode hole.
- 7 Do not compress the spring.
- 8 Adjust foot until tripod foot or spark shield are flat on top of NCD+ Set-Up Tool. Do not insert tripod standoffs into holes on tool.
- 9 Tighten leg screws to lock tripod foot or spark shield in place.

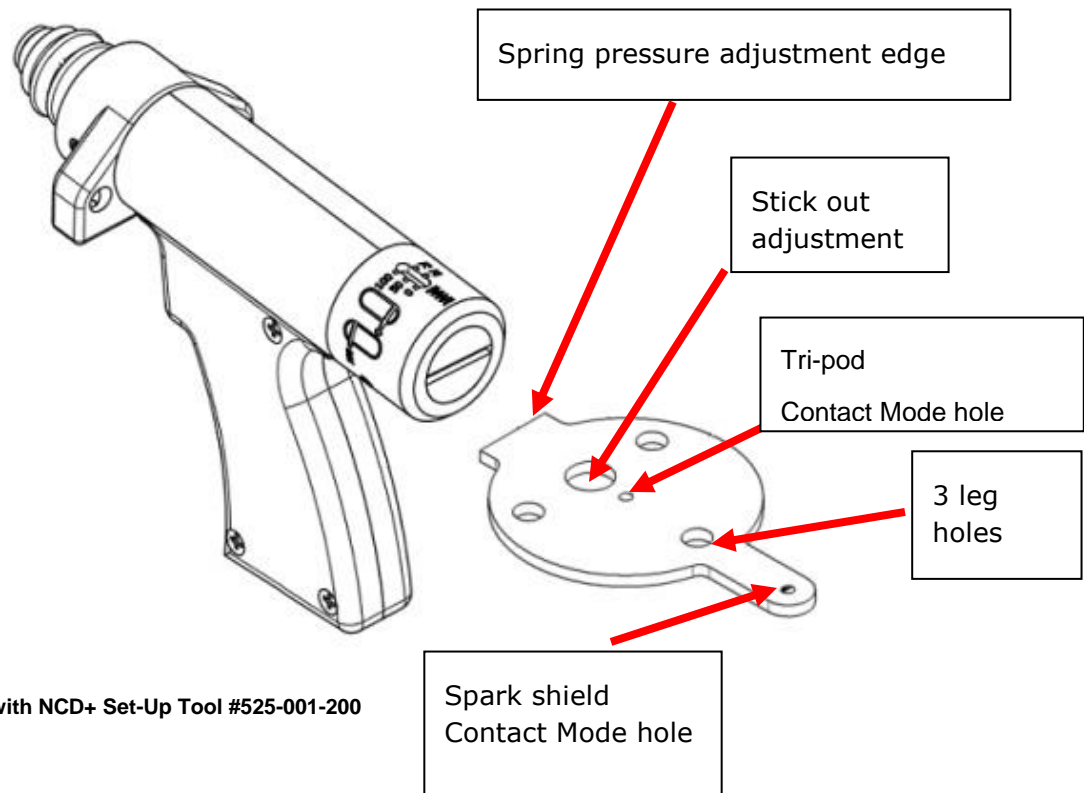


Figure 3.3 Contact Gun with NCD+ Set-Up Tool #525-001-200

## 4 Weld Setup

- 1 Confirm the power unit is switched off.
- 2 Connect gun and ground cables to the appropriate terminals.
- 3 Determine initial weld parameters in the Table of Weld Parameters.
- 4 Adjust voltage.
- 5 Install chuck and stud stop.
- 6 Set spring pressure using a stud per section 3.3.
- 7 Adjust plunge.  
*Plunge is the distance the stud extends beyond the stand-off posts (or spark shield). Loosen the leg locking screws and adjust the plunge to approximately 3mm and retighten the leg locking screws.*
- 8 Switch the power unit on.
- 9 Check concentricity of chuck and spark shield.
- 10 Replace the set up stud with a new one.
- 11 Begin production welding after sample welds have been validated for strength and appearance.

### 4.1 Post Weld

**During welding, it is very important to draw the chuck (gun) straight off the stud after a weld has been made to avoid spreading the chuck tines. If this procedure is not followed, chuck life may be substantially shortened.**

# 5 Maintenance of Stud Welding System

A majority of the maintenance of a stud welding system is in:

- 1 Stud Welding Gun
- 2 Welding Cable / Control Cable
- 3 Power Control Unit

## 5.1 Stud Welding Gun

The weld tool carries out most of the welding functions and should be periodically (at least every 3 months) disassembled and cleaned. Special attention should be given to the lifting mechanisms. This shaft must be absolutely free with no binding inside the gun and there should be no contact between the stud and the spark shield. Never lubricate the lifting mechanisms. It should be cleaned with a dry cleaner such as electrical contact cleaner. Caution should also be exercised when reassembling the gun to be certain not to pinch wires or the weld cable. This could cause erratic welding problems which are usually difficult to isolate.

## 5.2 Welding Cable / Control Cable

When checking cables for continuity, it is important to slightly pull on all the connectors so that if there is a break, the wires will be pulled apart. The continuity check can be performed with a standard Ohm meter. All cables: ground, control and the weld cables should be periodically inspected for damage. Repair or replace any damaged cables to protect the power control unit.

## 5.3 Power Control Unit

The power control unit contains electronic control boards. Normally, these items do not require maintenance. However, in harsh environments, particularly those with grinding or sanding, metallic dust can enter the welder. This conductive metallic dust can cause unexplained problems with the welding system. Periodically removing the power control unit cover and blowing out the power control unit is a good idea. Frequency will vary depending on the environment. Always disconnect power before opening any power control unit. CD units may continue to store energy after they have been unplugged. To ensure all energy is discharged, wait at least one minute before removing cover and servicing the power control unit.

# 6 Troubleshooting

## 6.1 Visual Weld Inspection and Weld Parameter Adjustments



**Situation:**  
Cold Weld



**Situation:**  
Acceptable Weld



**Situation:**  
Hot Weld

Figure 6.1 Weld Quality Visual Inspection

## 6.2 Weld Quality Physical Inspection and Weld Parameter Adjustments

If visually inspecting the welds reveals a questionable weld, the weld should be physically tested. Initial weld set ups should also be physically tested.

Suggested physical tests for steel and stainless steel studs are as follows:

1. **Bend Test.** Stud to be tested shall be bent away from its vertical axis 90° or until failure. Failure should occur in the stud shank, or, on thin plate, a full stud diameter plug of base metal should be torn out.
2. **Torque Test.** Stud shall be torqued until a pre- specified loading is attained or until the stud fails. On thin plate, a plug of the base material should tear out.

Physical test procedures for inspecting (magnesium) aluminum alloy studs are:

1. **Bend Test.** The stud to be tested shall be bent, using a bending tool approximately 15° away from its vertical axis before the stud breaks in the shank or the base material fails.
2. **Torque Test.** The stud to be tested shall be torqued in the conventional manner by applying torque until a predetermined torque load is reached or the stud fails.

### 6.2.1 Recommendations

Before starting any stud welding operation, or after the equipment has remained idle for a period of time, trial or test studs should be welded to a plate for testing. Testing should continue until there is no failure of a test stud.

**NOTE: Do not bend aluminum studs by striking with a hammer, always use a bending tool. The stud weld should not be damaged, only the stud shank or the base material.**

<b>Weld Issue</b>	<b>Weld Parameter Adjustments</b>
<p><b>Cold Weld</b> Weld failure at low strength value, no weld flash or splatter, and weld base is incompletely melted (very weak weld). This indicates that not enough heat was available.</p>	<p><b>Weld heat may be increased by:</b></p> <ul style="list-style-type: none"> <li>Decreasing gap setting when in gap mode - The shorter distance reduces the drop speed which allows for a longer arc or weld time.</li> <li>Reducing spring pressure - Reducing the drop speed and provides a longer weld time.</li> <li>Increasing voltage - Increasing the voltage increases overall energy into the weld.</li> <li>Check stud timing tips (possibly too short).</li> </ul>
<p><b>Hot Weld</b> Weld failure at low strength value, excessive weld flash and splatter, and weld base may be undercut (weak weld). This indicates that too much heat was available.</p>	<p><b>Weld heat may be decreased by:</b></p> <ul style="list-style-type: none"> <li>Increasing gap setting when in gap mode - The longer distance speeds up the weld time (faster drop time) and the faster drop time extinguishes the arc sooner.</li> <li>Increasing spring pressure - Speeding up the weld time and extinguishes the arc sooner.</li> <li>Decreasing voltage - Reducing the voltage reduces overall energy into the weld.</li> <li>Check stud timing tips (possibly too long).</li> </ul>
<p><b>Late or Cold Plunge</b> Cold plunge occurs when the stud contacts the base material after solidification of the molten weld metal has started. This results in inconsistent weld strength and is recognized by a shiny, mirror-like appearance in the fracture surface.</p>	<p><b>This issue can be rectified by:</b></p> <ul style="list-style-type: none"> <li>Increasing gap distance in gap mode - Increasing drop speed and gets the stud into the molten pool faster.</li> <li>Increasing spring pressure - Increasing drop speed and gets the stud into the molten pool faster.</li> <li>Decreasing voltage - Reducing the voltage reduces overall energy into the weld.</li> <li>Make certain that combo cable is installed (contact mode only). Otherwise (if gap mode), remove combo cable - Reducing the amount of weld energy consumed in the cables.</li> </ul>
<p><b>Misfire</b> No arc initiation due to timing tip failing to flash.</p>	<p><b>This issue can be rectified by:</b></p> <ul style="list-style-type: none"> <li>Increasing voltage.</li> <li>Using 10% detergent solution spray mist.</li> </ul>

<b>Problem: Cold Weld</b>	
<b>Possible Causes</b>	<b>Possible Solutions</b>
Tip on stud is crushed due to excessive pressure. Occasionally (especially with aluminum studs), an operator can apply repeated pressure to the timing tip and crush or shorten the tip. The shortened tip reduces arc length/time and does not properly melt the stud and/or base material.	Ensure plunge is properly adjusted. Refer to Sections 3.3 and 8.4.
Coiled weld or ground cables. This reduces weld current delivered to the stud. The coiled cables act like a large inductor and inhibit the flow of energy.	Ensure weld and ground cables are not coiled during the stud welding process.
Improperly set power supply controls.	Refer to the Section 3 Normal Operation within the Operating the Capacitor Discharge NCD+ Stud Welding Unit manual.
Improperly formed tip on stud due to manufacturing process.	Replace stud with one that is correctly formed.
Changes in alloys being welded.	Changes in alloys can usually be compensated for by changing the settings on the power supply.
Equipment failure.	Refer to the <b>Section 3 Normal Operation</b> within the Operating the Capacitor Discharge NCD+ Stud Welding Unit manual.



Improperly set plunge setting.	Decrease or increase the plunge. Refer to Sections 3.3 and 8.4.
Varying gauges of sheet metal.	Changes in sheet metal can usually be compensated for by changing the settings on the power supply.
Springs inside weld tool have fatigued and don't apply the same pressure.	Return weld tool to Nelson for service.
Dirt inside weld tool prevents smooth operation and hangs up or slows gun operation.	Clean weld tool in accordance with section 5.1.

<b>Problem: Arc Blow</b>	
Characterized by weld spatter of fillet on only one side of the stud (looks like molten metal was "blown" out from only the one side of the stud). This problem will often cause incomplete fillet formation on one side of the stud. This incomplete cross sectional welding may lead to weld failure.	
<b>Possible Causes</b>	<b>Possible Solutions</b>
Molten metal runs away from the ground. Incomplete or insufficient grounding can cause this problem.	Double Ground. The addition of another ground on opposite sides of the weld area will reduce this problem. The object will be to always weld between the grounds. If you need assistance contact your Nelson Representative.
Welding near the edge (1/4 inch or less) of a piece of metal will potentially cause these phenomena. Unusual electrical current patterns are set up near the edges of metals and this can affect the flow of molten metal.	Place another piece of sheet metal of the same type and thickness next to the edge you are welding. This will "fool" the electrical currents and they will act like you are welding in the middle of the sheet metal.

# 7 Assembly Drawing & Parts List

## 7.1 751-650-630, 751-650-640 Parts List

Item Number	PART NUMBER	QTY	DESCRIPTION
1	751-650-001	1	GUN BODY-RIGHT
2	751-650-002	1	GUN BODY-LEFT
3	751-650-003	1	COVER,FRONT,MACHINED
4	751-650-005	1	CAP,REAR, NCD+ CONTACT WELDGUN
5	751-650-006	1	BEARING,FRONT
6	751-650-007	1	BELLOWS,NCD/NCD+ HANDGUN
7	751-650-008	2	WASHER,LEG M5 ZINC
8	751-650-009	1	NUT,CHUCK
9	503-011-033	2	STOP PIN,NCD+500b
10	751-650-101	1	LIFTING ROD ASM
11	751-650-104	1	BEARING RETAINER
12	751-650-019	1	RETAINER,SPRING
13	751-650-020	1	NUT,ADJUSTING,SPRING
14	751-650-021	1	SCREW,ADJUSTING,SPRING
15	751-650-022	1	WASHER M4 BRASS
16	751-650-211	1	SWITCH, TRIGGER ASM.
17	751-650-027	1	TRIGGER BUTTON
18	751-585-021	1	E-RING
19	87-05-22	1	TRIGGER SPRING,4 WIRE
20	720-517-000	1	WELD CABLE JUMPER
21	524-005-097	4	SCREW,M5X5 FPSS ZINC DIN913
22	524-005-007	2	SCREW,M8X8 FPSS
23	524-005-100	3	SCREW,M4X16 OHMS ZINC
24	524-005-101	2	SCREW,M5X16 FHSC ZINC

Item Number	PART NUMBER	QTY	DESCRIPTION
25	524-005-102	1	SCREW,M4X12 FHSC DIN7991
26	524-005-104	1	NUT M5 THICK
27	524-005-105	1	SCREW,M5X10 SHC DIN912
28	524-005-003	1	SCREW,M4X6 FPSS
29	729-023-017	1	WASHER 5mm CONICAL SPRING
30	726-013-002	1	COLLET,NCD/NCD+ HANDGUN
31	526-001-231	1	SPRING,MAIN,NCD CONTACT GUN
32	502-001-347	1	FOOT,INSULATION PIN,NCD+500b
33	504-001-056	2	LEG,8mm x 110mm,SS
34	527-003-094	1	BEARING
35	524-005-103	2	SCREW,M3X5 LHS DIN7984
36	729-023-025	1	PIN,GROOVED,3 x 6,DIN #1472
37	524-001-284	2	NUT 10-24 HEX KEPS SS
38	713-032-000	2	SPLICE,WIRE,#16-20
39	717-093-002	2	O-RING,5/16IDx7/16ODx1/16W
40	721-268-014	1	CABLE,CONTROL ASM,NCD+,20FT,NNSY
	721-268-015	1	CABLE,CONTROL ASM, PINNACLE MAX
41	720-519-081	1	CABLE,WELD ASM,NCD+,19FT, STANDARD (630)
	720-519-082	1	CABLE,WELD ASM,NCD+,8FT, PINNACLE MAX (640)



## 7.3 Electrical Functions of Guns

### 7.3.1 Triggering Contact

The trigger switch is checked for proper functioning by connecting a continuity tester or ohmmeter at pin 3 of the control plug and to the foot plate.



If the switch provides a proper contact, the continuity tester will emit a signal or the ohmmeter will show 0 ohms.

### 7.3.2 Dismantling & Reassembling Contact Welding Gun

- 1 Loosen set screws in the front cover 3 and rear cap 4.
- 2 Remove the caps and lay the gun on its right side.
- 3 Remove 3 screws that hold the gun halves together.
- 4 Separate and remove the left gun body such that the internal components remain in the right half.
- 5 Inspect parts for damage or excessive wear and replace if necessary.
- 6 Reassemble in reverse order; The spring adjusting nut 13 should be oriented such that the radial screw 35 fits in the keyway in the gun body and the spring tension gage line is toward the top of the gun.
- 7 Reassemble the rear cap with the slot towards the top of the gun and the front cover with its bottom perpendicular to the gun handle.


Wire Code	
Pin #3	Trigger
Pin #4	Trigger

Located in Gun Handle	
White	Trigger
Black	Trigger
Brown	Weld Cable

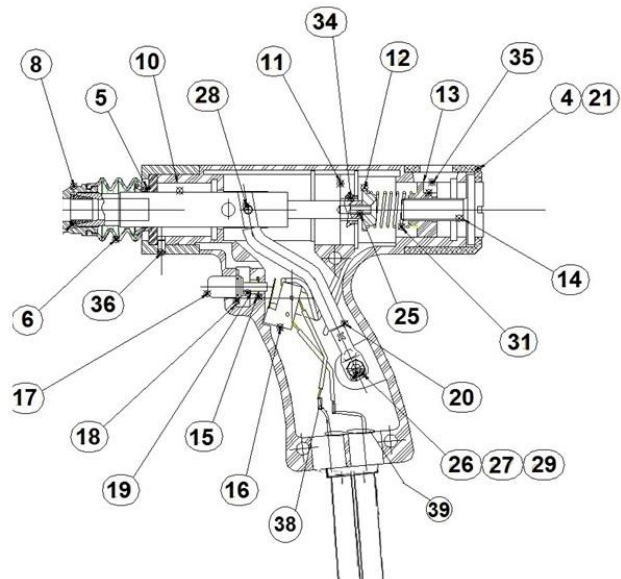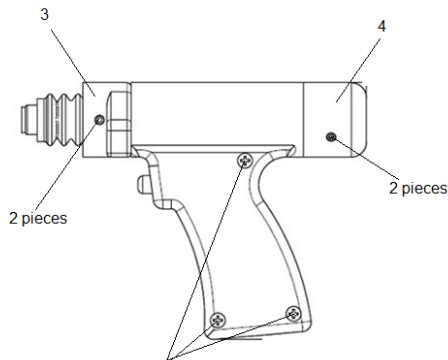

# 8 Schematics

## 8.1 NCD+ 500b CTRL TO GUN, 7 PIN

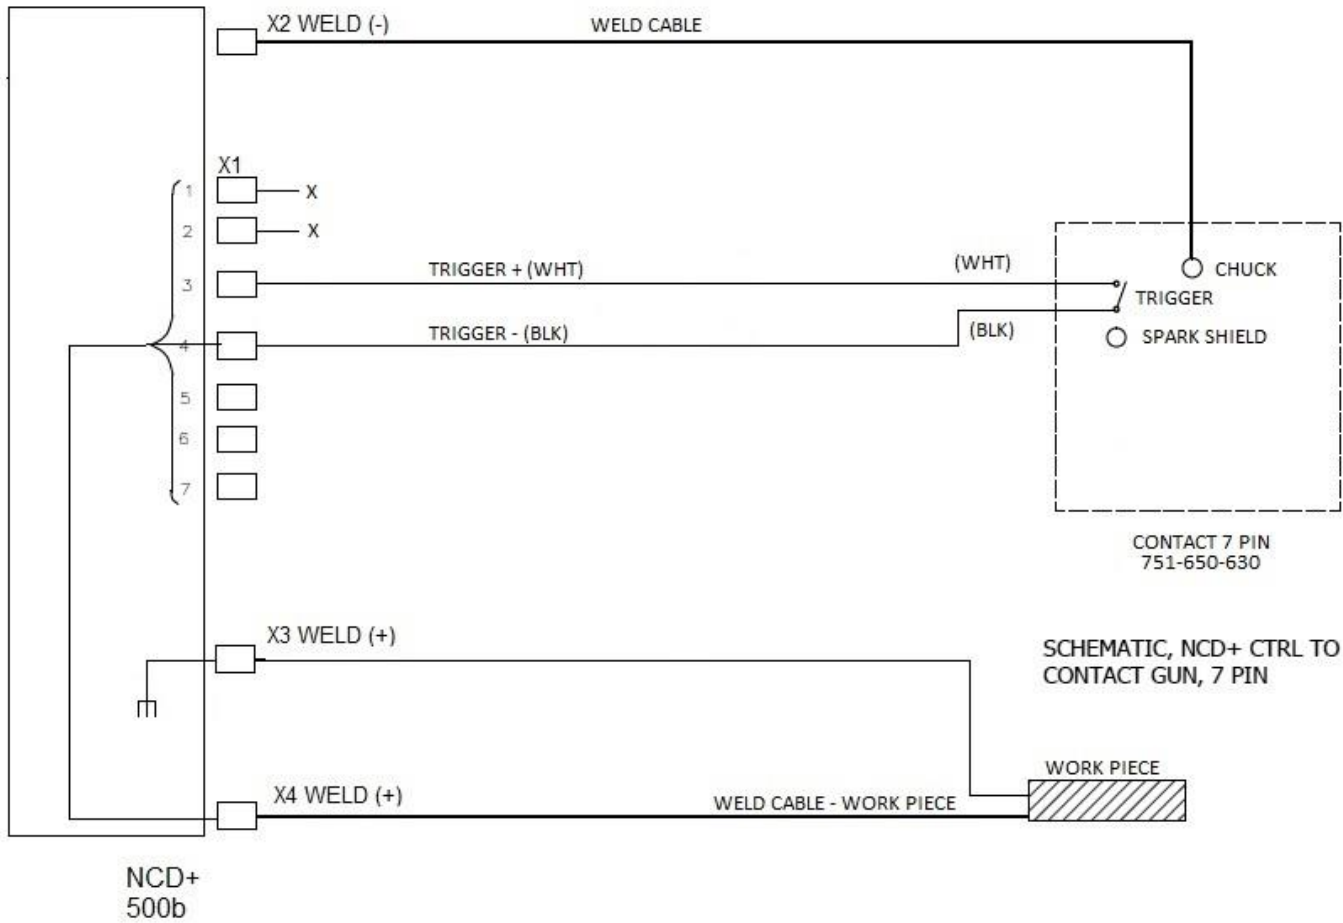


# 9 Technical Specifications

## 9.1 Specifications

Specifications	NCD+™ Contact Gun	
<b>Weld Mode</b>	Contact CD	
<b>Gap Mechanism</b>	N/A	
<b>Spring Pressure</b>	7 lb. (3.2 kg) – 15 lb. (6.8 kg)	
<b>Pressure Control</b>	Stepless Tool Adjustment	
<b>Gap Control</b>	N/A	
<b>Front Ends</b>	Adjustable, Tripod, Spark Shield	
<b>Max Stud Length</b>	Depends on Accessories	
<b>Dimensions without Cable</b>	6-5/8" x 1-1/2" x 5-1/2" (169 mm x 38 mm x 140 mm)	
<b>Weight without Cable</b>	2.2 lb. (1 kg) Max	
<b>Cable Length</b>	19 ft. (5.8 m) Standard	8 ft. Pinnacle Max
<b>Control Cable Connector</b>	7 Pin Binder	
<b>Power Cable Connector</b>	Medium Size Dinse	
<b>Maximum Gap</b>	N/A	
<b>Stud Capacity (max)</b>	1/4" flanged ( Pinnacle Max), 5mm (NCD+500b)	
<b>Storage Temperature (°C)</b>	-5°C to 50°C (23°F - 122°F)	
<b>Operating Temperature (°C)</b>	0°C to 40°C (32°F - 104°F)	
<b>IP Rating</b>	20	
<b>Stud Placement Tolerances</b>	+/- 0.010 (0.250 mm)	


## 9.2 Weld Tool Dimensions

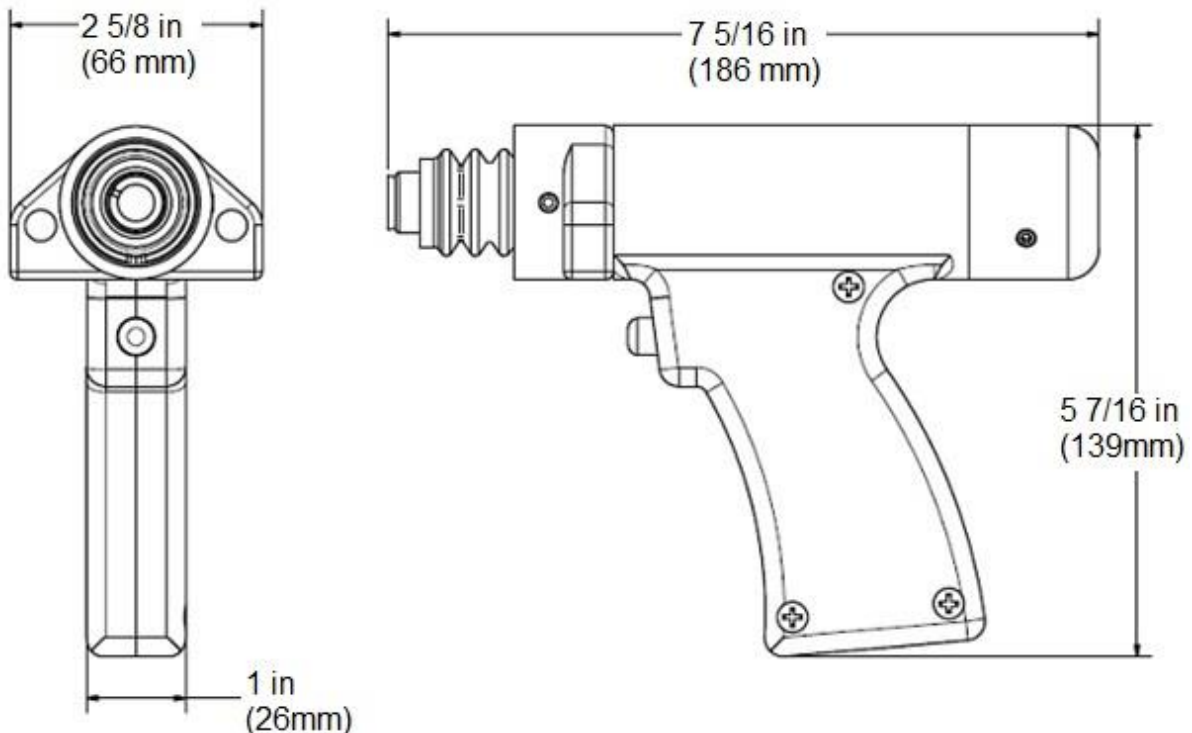


### 9.3 Accessories

Chucks					
Part Number	Stud Diameter, Ø	Chuck Size	Part Number	Stud Diameter, Ø	Chuck Size
500-001-374	0.095	13 Ga.	500-001-357	0.164	#8 Thd.
500-001-363	0.109	12 Ga.	500-001-372	0.172	3/16 Annular Ring (Navy Pin)
500-001-355	0.112/0.118	#4 Thd./3 mm	500-001-366	0.190	#10 Thd./3/16"
500-001-390	0.125	#5 Thd./1/8"	500-001-358	0.197	5 mm
500-001-356	0.134/0.138	10 Ga./#6 Thd.	500-001-359	0.250	1 / 4 "
500-001-361	0.157	4 mm	500-001-523		Chuck, Magnetic, CD Gun
Stud Stop Pin Assembly			500-015-094	1 3/16	Cupped Head Pin
			Tools		
Part Number	Stud Length		Part Number	Description	
500-017-017	1/4" - 5/8"		525-001-200	TOOL,NCD+ UNIVERSAL SET-UP	
500-017-018	3/4" - 1-1/8"		508-001-035	HEX KEY SET, METRIC	
500-017-019	1-1/4" - 1-5/8"				
500-017-020	1-3/4" - 2-1/8"				

#### 500-015-094

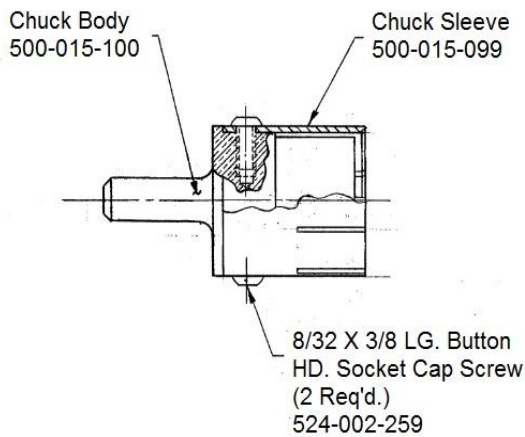

#### 500-001-523

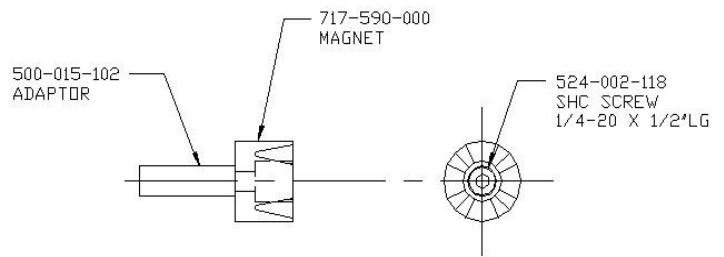



## 9.4 Table of Weld Parameters

Stud Size	Material	Plunge Depth		Pressure	NCD+ 500b Voltage
		In	mm	%	
12 ga. CHP/P2P (Point only)	Carbon Steel	0.16	4	0	80-85
10 ga. CHP/P2P (Point only)	Carbon Steel	0.2	5	0	95-100
#6 (M3)	Carbon Steel	0.12	3	100	70
	Stainless Steel	0.12	3	100	60
#8 (M4)	Carbon Steel	0.12	3	0	80
	Stainless Steel	0.12	3	100	70
#10 (M5)	Carbon Steel	0.12	3	50	90
	Stainless Steel	0.12	3	25	80
1/4 " (See Notes)	Carbon Steel	0.12	3	100	100
	Stainless Steel	0.12	3	100	95-100

- Weld parameters above were established as optimum for conditions in our lab. Heavy base plate material was used for physical testing purposes. Local conditions and/or plate thickness differences may necessitate parameter adjustments.
- Weld parameters above were established without the use of 10% detergent solution. If detergent solution is preferred, the amount of weld heat will generally have to be increased, i.e., increase voltage and/or reduce spring pressure.
- If settings are needed (or desired) other than those listed above, please consult your Nelson representative.
- **1/4" Studs**
  - When subjected to loads above yield, the success rate of 1/4" studs with an unthreaded shank is dependent on the diameter of the flange. It is generally recommended that the stud flange diameter be 0.300" or less, although the type of stud and base material may provide some relaxation.
  - Parameter established using Nelson Contact Gun 751-650-630 with 8' x 1/0 AWG conductor cable and 11' x 2/0 AWG ground. Flanged studs were used.



# 10 Contact Information

North America Sales Offices and Warehouses			
<p><b>*Chicago</b> 18601 Graphic Court Tinley Park, IL 60477 708.430.3770 <b>Phone:</b> 800.635.9353 <b>Fax:</b> 708.430.3975</p>	<p><b>*Philadelphia</b> 260 Boot Road Downingtown, PA 19335 <b>Phone:</b> 610.873.0012 800.635.9353 <b>Fax:</b> 610.873.2550</p>	<p><b>**Elyria</b> 7900 West Ridge Road P.O. Box 4019 Elyria, OH 44036-2019 <b>Phone:</b> 440.329.0400 <b>Fax:</b> 440.329.0521</p>	<p><b>*Westlake</b> 821 Sharon Drive Westlake, OH 44145 <b>Phone:</b> 440.250.9242</p>
<p><b>*Dallas</b> 2211 Century Center Blvd. Suite 105 Irving, TX 75062 <b>Phone:</b> 972.721.9055 800.635.9353 <b>Fax:</b> 972.438.7883</p>	<p><b>*San Francisco</b> 23765 Foley Street Hayward, CA 94545 510.293.0660 <b>Phone:</b> 800.635.9353 <b>Fax:</b> 510.293.0677</p>	<p><b>*Toronto</b> 6199A Danville Rd. Mississauga, Ontario Canada L5T 2H7 <b>Phone:</b> 905.795.8277 800.635.9353 905.795.8275</p>	<p><b>*Los Angeles</b> 20621B East Valley Blvd. Walnut, CA 91789-2731 <b>Phone:</b> 909.468.2105 800.635.9353 <b>Fax:</b> 909.468.2112</p>
Subsidiaries		International	
<p><b>England   Nelson U.K. Ltd.</b> 47-49 Edison Rd. Rabans Lane Ind'l Estate Aylesbury HP19 8TE, UK <b>Phone:</b> 44.1296.433500 <b>Fax:</b> 44.1296.487930</p>		<p><b>Middle East &amp; Europe   Nelson Germany</b> Postfach 40-20 58272 Gevelsberg Germany <b>Phone:</b> 49.2332.661.0 <b>Fax:</b> 49.2332.661.165</p>	
<p><b>France   Nelson Frances S.A.S.</b> Z. 1 du Chemin Vert 8 rue de l'Angoumois F-95100 Argenteuil, France <b>Phone:</b> 33.1.3411.9400 <b>Fax:</b> 33.1.3411.2033</p>		<p><b>Asia/Pacific   Nelson Germany</b> Postfach 40-20 58272 Gevelsberg Germany <b>Phone:</b> +86-22-24990335 <b>Fax:</b> +86-22-24995663 <b>World Wide Web:</b> <a href="http://NelsonStudWelding.com">NelsonStudWelding.com</a> <b>E-mail:</b> <a href="mailto:Nelson.Sales@NelsonStud.com">Nelson.Sales@NelsonStud.com</a></p>	
<p><b>Germany   Nelson Germany</b> <b>Mailing Address</b> Postfach 40-20 58272 Gevelsberg Germany <b>Shipping Address</b> Flurstrasse 7-19 58285 Gevelsberg Germany <b>Phone:</b> 49.2332.661.0 <b>Fax:</b> 49.2332.661.165</p>		<p><b>Central &amp; South America</b> P.O. Box 3990 Seminole, FL 33775 USA <b>Phone:</b> 727.596.9600 <b>Fax:</b> 727.593.3494</p>	
<p><b>Italy   Nelson Italy</b> Via Miraflores, 20 Nichelino, (TO) I-10042 Italy <b>Phone:</b> 39.011.6059238 <b>Fax:</b> 39.011.6059230</p>		<p><b>For Distributors in specific areas call:</b> <b>440.329.0400</b> <b>General Offices</b> 7900 West Ridge Rd. P.O. Box 4019 Elyria, OH 44036-2019 USA <b>Phone:</b> 440.329.0400 <b>Fax:</b> 440.329.0597 <b>World Wide Web:</b> <a href="http://NelsonStudWelding.com">NelsonStudWelding.com</a> <b>E-mail:</b> <a href="mailto:Nelson.Sales@NelsonStud.com">Nelson.Sales@NelsonStud.com</a></p>	